

# WOLF SECTIONAL BEAM

## ASSEMBLY INSTRUCTIONS



Find out more at [schachtspindle.com](http://schachtspindle.com)  
Schacht Spindle Company 6101 Ben Place Boulder, CO 80301  
p. 303.442.3212 f. 303.447.9273

© 2011 Schacht Spindle Company, Inc.

04.11

# WOLF SECTIONAL BEAM

## ASSEMBLY INSTRUCTIONS

### PARTS FOR BABY WOLF

- 8 – #8 • 1½" PFH tapping screws
- 60 – dowels
- 1 – hammer block
- 4 – sectional beam leaves
- 14 – 40" long cords

### TOOLS

- Hammer or mallet
- Phillips screwdriver
- Drill and 1/8" drill bit

### PARTS FOR MIGHTY WOLF

- 12 – #8 • 1½" PFH tapping screws
- 80 – dowels
- 1 – hammer block
- 4 – sectional beam leaves
- 20 – 40" long cords

**1.** Install the dowels into the four wood sections. Place the rounded end of a dowel into the hole in the end of the hammer block (Figure A). Align the flat end of the dowel with the hole in the section and tap the dowel in. If any of the dowels fit loosely, glue them in with a little wood glue.

**2.** Insert the wood screws into their holes in a sectional beam leaf (wood section). The points of the screws should extend out of the hole about 1/2".

**3.** Place the wood section on one of the flat sides of the octagonal warp beam, butting it up against the aluminum brake drum. Hold the section square and even along the warp beam, and tap gently on the wood screws to make small marks in the beam.

**4.** Remove the wood section. At each of the marks, drill a 1/8" diameter hole about 3/4" deep. Now screw the wood section to the warp beam. Repeat this process for the other three wood sections.

**5.** Make loops of the provided cords by tying both ends together with an overhand knot. Insert the cord loops through the holes that have been drilled between the dowels on each of the wood sections and through the knotted end of the cord as illustrated in Figure A. Pull the loop to tighten the cord against the section.

**NOTE: Once the sectional beam is installed on an 8 shaft loom, the loom cannot be folded up completely.**

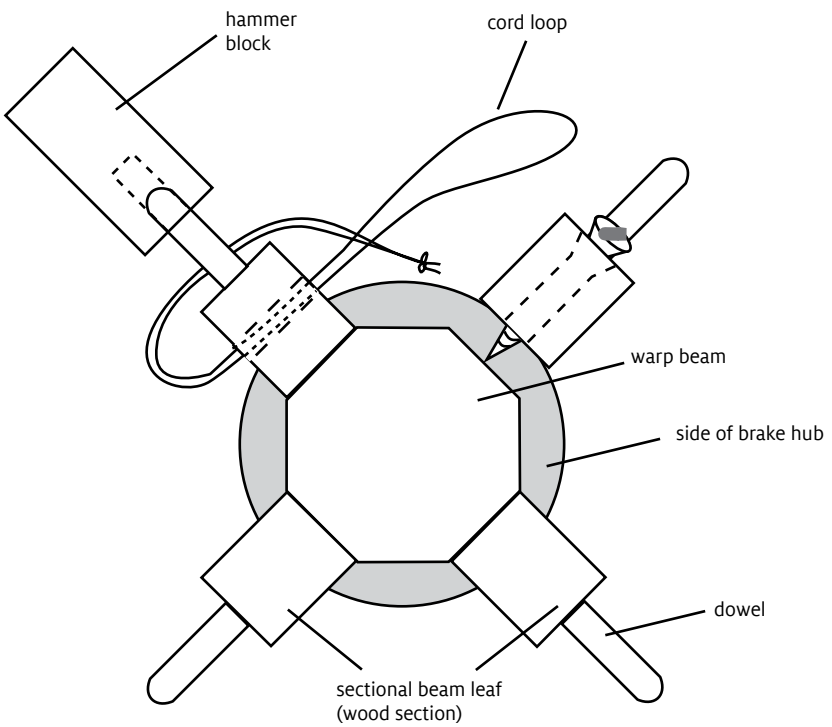


FIGURE A

# OTHER WEAVING ACCESSORIES



Double Back Beam  
(shown on 8 shaft Baby Wolf)



Wolf Loom Raddle



Wolf Trap



Horizontal and Vertical Warping Mills